

PosiTest[®] **OTL**

Oven Temperature Logger

Measures and records oven temperature profiles

NEW



Record up to 40,000 datasets
into 6 independent batches

High temperature stainless steel
barrier box for long run times



DeFelsko[®]
The Measure of Quality

GRUPPO **INL**[®]
EXPERTOS EN MAQUINARIA

www.grupoinl.com
info@grupoinl.com

PosiTest[®] OTL

Oven Temperature Logger

The PosiTest OTL Oven Temperature Logger with included barrier box and holder is ideal for measuring oven temperature profiles.

Features


- Simple, easy-to-use interface
- 6 K-type thermocouple ports (channels)
- Measures and records up to 40,000 datasets (240,000 readings) in up to 6 batches
- Records measurements every 2 seconds for up to 22 hours of recording time
- Download, view, and analyze batch data using PosiSoft Desktop software. Export .CSV files for easy import into spreadsheets.
- Bright LEDs indicate logger status at a glance
- High temperature stainless steel barrier box with fiberglass insulation for long run times at high temperatures. Contains no silicone.
- Certificate of Calibration showing traceability to NIST included

Temperature Probes

- Wide variety of temperature probes available with 1.8, 3.6, or 6 m (6', 12', or 20') stainless steel braided cables (sold separately). See the following page for details.
- Certificate of Calibration showing traceability to NIST included

Two Kits available

The PosiTest OTL is available in two configurations. The PosiTest OTL XT features an enhanced holder with heatsink for greater endurance at high temperatures.

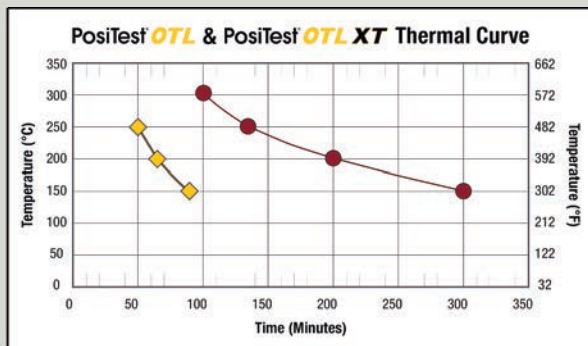

◆ PosiTest OTL Kit

● PosiTest OTL XT Kit

	PosiTest OTL (OTLKIT)	PosiTest OTL XT (OTLKITXT)
150° C (302° F)	90 minutes	300 minutes
200° C (392° F)	65 minutes	200 minutes
250° C (482° F)	50 minutes	140 minutes
300° C (572° F)	not recommended	100 minutes

The chart and table above represent the combined thermal characteristics of the PosiTest OTL, Barrier Box and choice of Holder/Holder XT

Ordering Guide

PosiTest OTL Kit	OTLKIT
PosiTest OTL XT Kit	OTLKITXT

PosiTest OTL Specifications

Channels	6 K-type non-grounded thermocouples
Thermocouple Measurement Range	-100 to 1000° C -148 to 1832° F
Logger Operating Temperature Range PosiTest OTL without Holder or Barrier Box	0 to 70° C 32 to 158° F
Logger Accuracy	±0.5° C ±0.9° F
Resolution	0.1° C 0.1° F
Memory	40,000 Datasets. Each Dataset consists of up to 6 channels.
Sample Interval	2 seconds (Fixed) Maximum recording time is 22 hours

Power Source: 2 AAA batteries

Battery Life: 30 hours (recording time)

Size: 30.5 x 25.5 x 15 cm (12" x 10" x 6")

Weight:* 9 kg (20 lbs.)

* Weight includes the PosiTest OTL, Holder, and Barrier Box. Holder XT increases weight to 11 kg (25 lbs.).




LOGGER KITS COME with temperature logger, stainless steel high temperature barrier box, choice of holder, 6 engraved probe ID tags, two AAA batteries, instructions, Long Form Certificate of Calibration traceable to NIST, carrying case, USB cable, PosiSoft Desktop software, and two year warranty.



Temperature Probe Options

Temperature Probes	Temperature Range	Order Code
Spring Clamp – Surface Probe: 1.8 m (6')	-100 to 500°C -148 to 930°F	PRBOTLCS6
Spring Clamp – Surface Probe: 3.6 m (12')		PRBOTLCS12
Spring Clamp – Surface Probe: 6 m (20')		PRBOTLCS20
Spring Clamp – Air Probe: 1.8 m (6')	-100 to 300°C -148 to 570°F	PRBOTLCA6
Spring Clamp – Air Probe: 3.6 m (12')		PRBOTLCA12
Spring Clamp – Air Probe: 6 m (20')		PRBOTLCA20
Magnetic – Surface Probe: 1.8 m (6')	-100 to 300°C -148 to 570°F	PRBOTLMS6
Magnetic – Surface Probe: 3.6 m (12')		PRBOTLMS12
Magnetic – Surface Probe: 6 m (20')		PRBOTLMS20
Magnetic – Air Probe: 1.8 m (6')	-100 to 300°C -148 to 570°F	PRBOTLMA6
Magnetic – Air Probe: 3.6 m (12')		PRBOTLMA12
Magnetic – Air Probe: 6 m (20')		PRBOTLMA20
Washer – Surface Probe: 1.8 m (6')	-100 to 500°C -148 to 930°F	PRBOTLW6
Washer – Surface Probe: 3.6 m (12')		PRBOTLW12
Washer – Surface Probe: 6 m (20')		PRBOTLW20

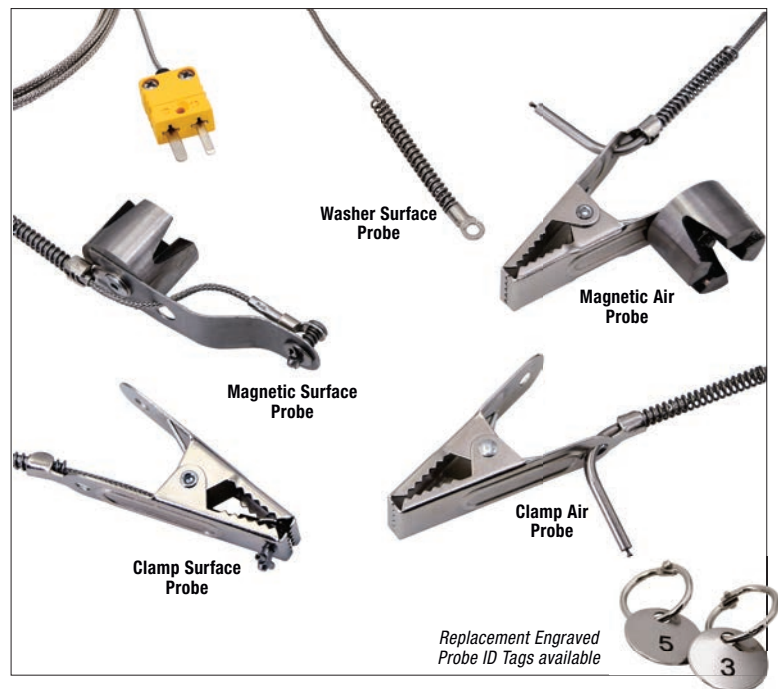

PosiSoft Desktop

FREE powerful desktop software (PC/Mac) for downloading, viewing, printing, and storing measurement data.

Add batch annotations, label individual channels, set threshold temperatures, and compare datasets to reference batches. Includes a customizable, templated PDF Report Generator. No internet connection required.

Graph Readings for up to 6 channels and compare to stored reference profiles

Add imagery and notes to any report

Add an image to identify probe placement

Add up to 3 Threshold Temperatures to calculate Time above Temperature


Rename channels

Use cursor to hover and identify individual channels (traces)

Store optimal cure reference profiles to compare measurement results

Select one or more reference channels to plot alongside measurement data

Start At Temperature sets the time to 00:00 when the selected channel reaches the threshold temperature, making it easier to compare logged batch results with reference data

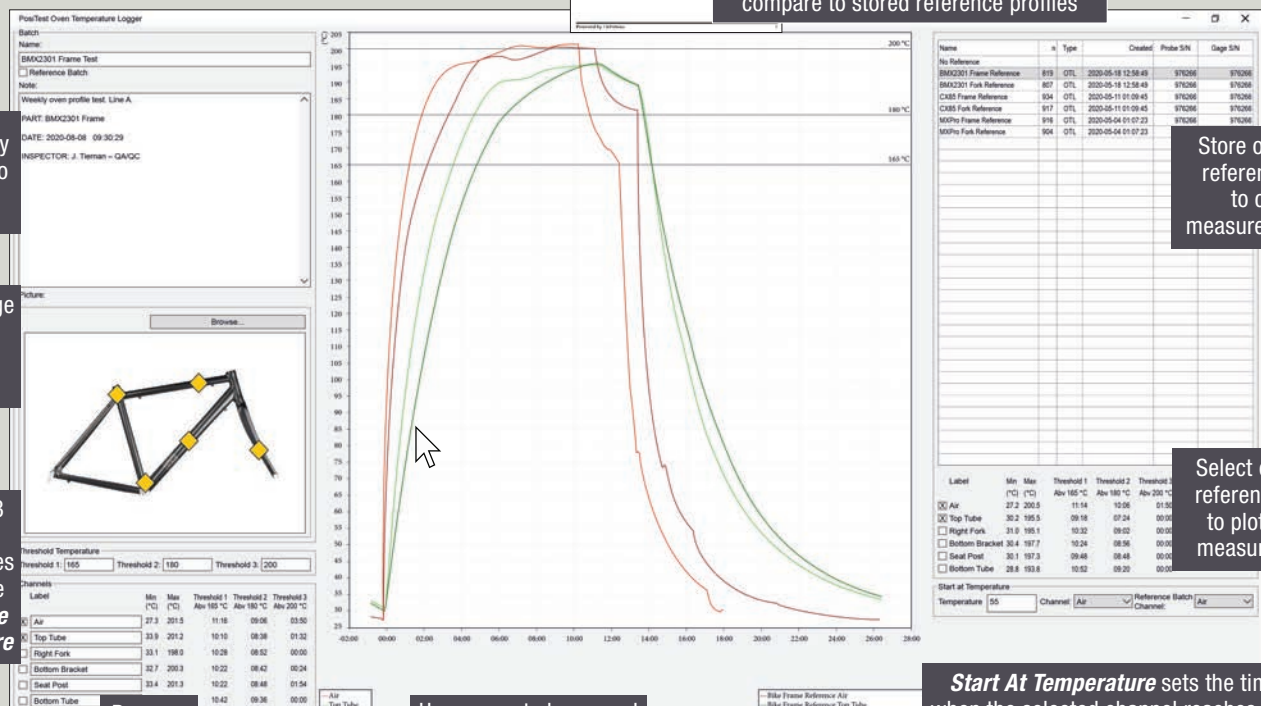

Coating Thickness Gages for Before and After Cure

1) PosiTector 6000 Series

Standard and Advanced features for measuring coating thickness on ALL metal substrates

2) PosiTest DFT Dry Film Thickness Gage

Economical coating thickness gage for ALL metal substrates

3) PosiTest PC Powder Checker

Non-contact coating thickness gage for measuring uncured powder coating thickness to predict a cured thickness

4) DeFelsko Powder Comb

Notched comb for measuring uncured powder height to ensure correct cured film thickness

5) Powder Inspection Kit

Complete solutions for measuring powder coating before and after cure

Each kit contains:

- PosiTector PC Uncured Powder Thickness Gage
- Choice of dry film thickness gage
- Two DeFelsko Powder Combs (models 1 and 4)

Select from 6 pre-configured kits or build your own at www.defelsko.com/PCKits




PosiSoft® Suite of Software

Powerful ways to view and report your PosiTector and PosiTest data

PosiSoft Desktop — PC/Mac


Powerful desktop software for downloading, archiving, and reporting measurement data.

- Import readings directly from the gage via USB, WiFi, or legacy PosiSoft Desktop versions
- **Jobs feature** consolidates batches into groups to keep measurement data organized and to quickly create multi-batch reports
- Fully integrates with PosiSoft.net—backup and synchronize jobs, batches, readings, and report templates to the cloud (see inset at right)
- Export readings as .csv (comma separated value) files for easy import into Excel and other spreadsheets

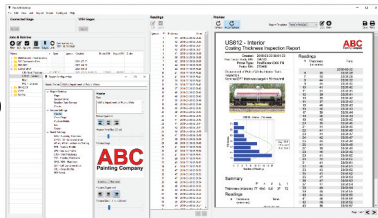

Professional, Custom Reports

- Compile single or multi-batch reports from multiple probes and instrument types
- Add pictures, screen captures, notes, and more with an onscreen live preview
- Instantly create professional reports from pre-formatted report templates
- Design custom layouts and templates—add custom cover pages and logos, and choose to display charts, histograms, and/or individual readings
- Drag-and-drop Custom Fields mode—import PDF forms and overlay fields to automatically populate inspection data

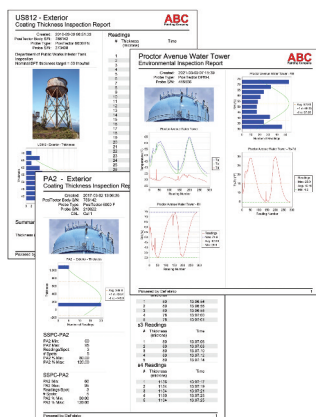


Prompted Batch Mode

Create pre-defined batches with onscreen text and image prompts for each reading and upload to PosiTector 6000, 200, and UTG gages (*Advanced models only*).

- Ideal for ensuring a consistent measurement pattern for repetitive jobs or when specific measurement locations are required

PosiSoft USB Drive — Gage based

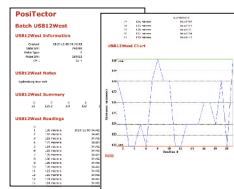


A simple gage interface to retrieve data in a manner similar to USB flash drives or cameras. No software to install or internet connection required. Measurement data can be printed quickly from a formatted HTML report or exported in .csv format for further analysis in spreadsheets.

PosiTector App — iOS/Android


Fully-featured mobile app that connects to the PosiTector SmartLink, PosiTector Advanced gages, and the PosiTest AT-A.

- Auto pairing Bluetooth BLE connection
- Add images and notes to individual readings or batches directly from your device
- Email readings as .csv (comma separated value) files for easy import to Excel and other spreadsheets.
- Synchronize readings with PosiSoft.net—backup and synchronize jobs, batches, and readings to the cloud (see inset below)

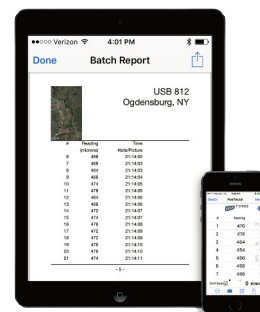

Mobile Reporting Solution

- Compile single or multi-batch reports from multiple probes and instrument types
- Add pictures, screen captures, notes, and more
- Email pre-formatted or custom reports from your device instantly

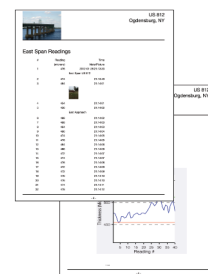

PosiSoft.net


Secure storage of measurement data in the cloud.

compatible with **PosiSoft Desktop** and **PosiTector App**

- Upload measurement data directly from WiFi-connected PosiTector Advanced gages from anywhere in the world—no software required
- Synchronize and share measurement data across multiple computers

Ideal for...

- Users with multiple computers, instruments, and office locations
- Inspection companies managing data from multiple inspectors
- Login from PosiSoft Desktop to synchronize all measurement data and stored report templates from your account

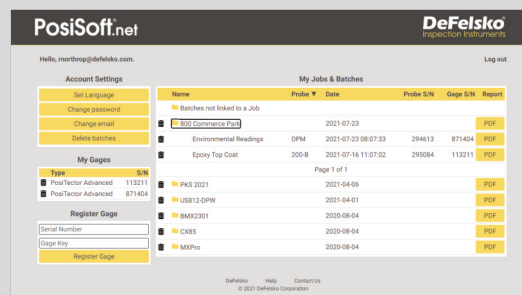

PosiSoft.net Web Viewer Review measurement data and print simple, pre-formatted PDF reports from any web browser—no software installation required.

PosiTector Developer Resources

•Bluetooth 4.0 •WiFi •Keyboard Mode •USB Serial

PosiTector and PosiTest AT-A instruments can integrate with third-party software, drones, ROVs, PLCs, and robotic devices using several industry-standard communication protocols including: Bluetooth 4.0, WiFi, Keyboard mode, and USB serial.

